

AD-A036 009

NAVAL AIR DEVELOPMENT CENTER WARMINSTER PA AIR VEHICL--ETC F/G 13/12
INVESTIGATION OF A LIQUID OXYGEN SAMPLER CYLINDER EXPLOSION.(U)
DEC 76 J DANOVIH, E R WRIGHT

UNCLASSIFIED


NADC-76332-30

NL

| OF |

AD
A036009

DATE
FILMED

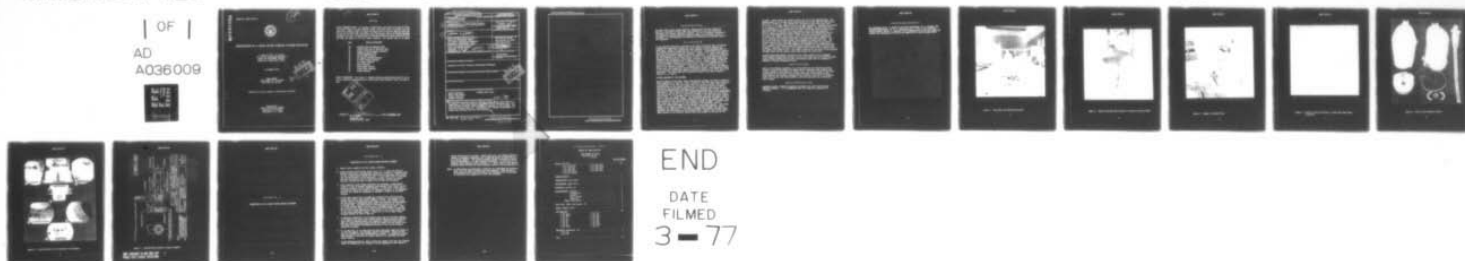



MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

AD 036009

REPORT NO. NADC-76332-30



INVESTIGATION OF A LIQUID OXYGEN SAMPLER CYLINDER EXPLOSION

J. Danovich and E. R. Wright
Air Vehicle Technology Department ✓
NAVAL AIR DEVELOPMENT CENTER
Warminster, Pennsylvania 18974

10 DECEMBER 1976

FINAL REPORT
WORK REQUEST NO. WR 5043W
Work Unit No. RH 301



APPROVED FOR PUBLIC RELEASE; DISTRIBUTION UNLIMITED

Prepared for
NAVAL AIR SYSTEMS COMMAND
Department of the Navy
Washington, D.C. 20361

NOTICES

REPORT NUMBERING SYSTEM - The numbering of technical project reports issued by the Naval Air Development Center is arranged for specific identification purposes. Each number consists of the Center acronym, the calendar year in which the number was assigned, the sequence number of the report within the specific calendar year, and the official 2-digit correspondence code of the Command Office or the Functional Department responsible for the report. For example: Report No. NADC-76015-40 indicates the fifteenth Center report for the year 1976, and prepared by the Crew Systems Department. The numerical codes are as follows:

CODE	OFFICE OR DEPARTMENT
00	Commander, Naval Air Development Center
01	Technical Director, Naval Air Development Center
02	Program and Financial Management Department
09	Technology Management Office
10	Naval Air Facility, Warminster
20	Aero Electronic Technology Department
30	Air Vehicle Technology Department
40	Crew Systems Department
50	Systems Department
60	Naval Navigation Laboratory
81	Technical Support Department
85	Computer Department

PRODUCT ENDORSEMENT - The discussion or instructions concerning commercial products herein do not constitute an endorsement by the Government nor do they convey or imply the license or right to use such products.

Approved by	File Section	<input type="checkbox"/>
File	Mail Section	<input type="checkbox"/>
NO		
DOC		
MANAGEMENT		
RESTRICTION		
BY	DISTRIBUTION/AVAILABILITY CODES	
Dist.	AVAIL. and/or SPECIAL	
A		

APPROVED BY:

P. M. STURM

Commander, USN
Deputy Director, AVTD

DATE: 10 December 1976

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER (14) NADC-76332-30	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) INVESTIGATION OF A LIQUID OXYGEN SAMPLER CYLINDER EXPLOSION	5. TYPE OF REPORT & PERIOD COVERED (9) FINAL rpt.	
7. AUTHOR(s) J. DANOVICH E. R. WRIGHT	6. PERFORMING ORG. REPORT NUMBER NADC-76332-30	
9. PERFORMING ORGANIZATION NAME AND ADDRESS NAVAL AIR DEVELOPMENT CENTER Air Vehicle Technology Department Warminster, Pennsylvania 18974	8. CONTRACT OR GRANT NUMBER(s)	
11. CONTROLLING OFFICE NAME AND ADDRESS NAVAL AIR SYSTEMS COMMAND Department of the Navy Washington, DC 20361	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS Work Request WR 5043W Work Unit RH 301	
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)	12. REPORT DATE 10 December 1976	
	13. NUMBER OF PAGES 15	
	15. SECURITY CLASS. (of this report) UNCLASSIFIED	
	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE	
16. DISTRIBUTION STATEMENT (of this Report) Approved for Public Release; Distribution Unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Oxygen explosion Fusible metal alloy Navy G-276 sampler Safety relief nut Frosted cylinder Liquid Oxygen		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) An explosion occurred because an improper silver solder joint permitted a separation to take place between the nipple and the stainless steel tube which allowed an excess volume of LOK to accumulate in the cylinder, thus an excess pressure built up. The presence of a fusible alloy behind the safety disc prevented the disc from bursting.		

DD FORM 1473
1 JAN 73EDITION OF 1 NOV 65 IS OBSOLETE
S/N 0102-014-6601

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

407 207

mit

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

INTRODUCTION

Two Navy G-276 liquid oxygen samplers, charged with LOX from a Naval Air Facility, Warminster storage tank, were delivered to the Aero Materials Laboratory for routine laboratory analysis. One of the samplers exploded in the laboratory causing extensive property damage, but only minor injury to personnel. An investigation was conducted to determine the probable cause of the explosion.

DISCUSSION

It was noted by laboratory personnel at the time of delivery that one sampler cylinder was completely covered with frost whereas the other sampler was frost-free. While test preparations were underway a steel retaining band on the frosted cylinder cracked and fell to the floor. Approximately five minutes later the frost-covered cylinder exploded. Figures 1, 2, 3 and 4 show some of the extensive physical damage caused by the explosion. A laboratory technician who was standing in the location shown in Figure 1 sustained minor cuts and a temporary loss of hearing. Three major sections of the exploded cylinder came to rest in the locations shown in Figures 2 and 3. Figure 4 shows a typical G-276 LOX sampler cylinder in a stand near an area of the damaged wall in the hallway and some of the shattered steel bands. Figure 5 shows the various parts of the exploded cylinder. It appears that the valve, nipple and sampler filler tube, upon separation from the exploding cylinder, were propelled upward to the ceiling, causing some damage and finally landing on the floor about four feet apart. The wire bands were scattered throughout the area as shown in Figures 1, 2, 3 and 4.

FAILURE ANALYSIS OF THE CYLINDER

Detailed photos of the tube, nipple and exploded cylinder are shown in Figure 6. Close examination of photos 1, 2 and 3 (Figure 6) show that many areas along the circumference of the tube and nipple were void of silver solder (see arrows). Specifications of the nipple assembly from the Naval Air Station, Alameda, California, O&R Department Drawing 212258 of 5 December 1958 (Figure 7) show that the stainless steel tube should have been recessed into a 0.26" (0.66 cm) counterbore. The SS tube from the exploded sampler was found to be counterbored less than 0.062" (0.158 cm), practically forming a butt weld with very little filler metal. It is believed that a crack between the tube and nipple existed prior to the last sample charge. This separation permitted an excess volume of LOX to overflow into the cylinder during the filling of the sampler tube. The discoloration of the inside of the cylinder as shown in Figure 5 (arrow) shows that liquid was present in the lower portion of the cylinder. Photo 4 (Figure 6) shows some damage to the threads of the nipple adaptor. The slight damage to the nipple threads and also to the cylinder threads (not shown) indicates the separation of the adaptor assembly and cylinder occurred simultaneously with the rupture of the cylinder walls. Photos 5 and 6 show cracks (open arrows) in the interior surface below the threads in the neck of the

cylinder. These cracks are visible without the aid of any magnification. The maximum depth of the cracks found three-fourths of an inch from the ANPT thread was 0.015" (0.038 cm). The minimum wall thickness at this point was 0.343" (0.871 cm), or a crack depth of 4.5% of the wall thickness. Cracking was detected to a distance of 1-3/4" (4.445 cm) from the ANPT thread. At this point the crack penetrated to a maximum depth of 0.0075" (0.019 cm) where the wall thickness was 0.156" (0.396 cm), or a crack depth of 5% of the wall thickness. Photo 7 shows the pressure relief assembly nuts which are extensively used on the Navy G-276 sampler exit valves. These nuts have access ports which can be filled with fusible metal alloy which will melt when excess temperatures occur, allowing the safety rupture disc to release the excess pressure. The nut on the left has a fusible metal alloy behind the safety burst disc. The pressure relief nut on the right shows no fusible metal alloy in the access ports. Since all Navy G-276 LOX samplers are designed for low temperature use, the presence of the fusible metal alloy would prevent the escape of excess LOX pressure. Therefore, all Navy G-276 sampler valves should have a safety relief nut without the fusible alloy. The safety relief nut on the valve of the exploded cylinder still had the fusible metal alloy behind the safety disc.

Infrared spectrophotometric analysis of the oxygen sample in the undamaged G-276 sampler charged from the same source at the same time as the malfunctioned sampler showed satisfactory quality of breathing oxygen with no evidence of abnormal or excess contaminant levels.

CONCLUSIONS

Based on the evidence available, it is believed that the explosion occurred because a separation between the nipple and the stainless steel sampler tube allowed leakage of LOX beyond the filler tube. The excess volume of LOX which accumulated in the bottom of the cylinder produced a gas pressure buildup which exceeded the bursting strength of the cylinder. The use of an unbacked safety disc on the vent valve assembly would have permitted the pressurized gas to escape.

RECOMMENDATIONS

Appendix A gives a detailed inspection procedure for G-276 Liquid Oxygen Sampler Cylinders. It is recommended that this inspection procedure be followed.

A C K N O W L E D G E M E N T S

The assistance of Mr. A. Shanks of the Photo Department, Mr. M. Perlman, the Infrared Technologist, Mr. E. F. Deasing and Mr. E. Neu of the Structural Alloys Section, and Mr. G. McConnell of the Nondestructive Test and Inspection Section for constructive criticism and suggestions is greatly appreciated.

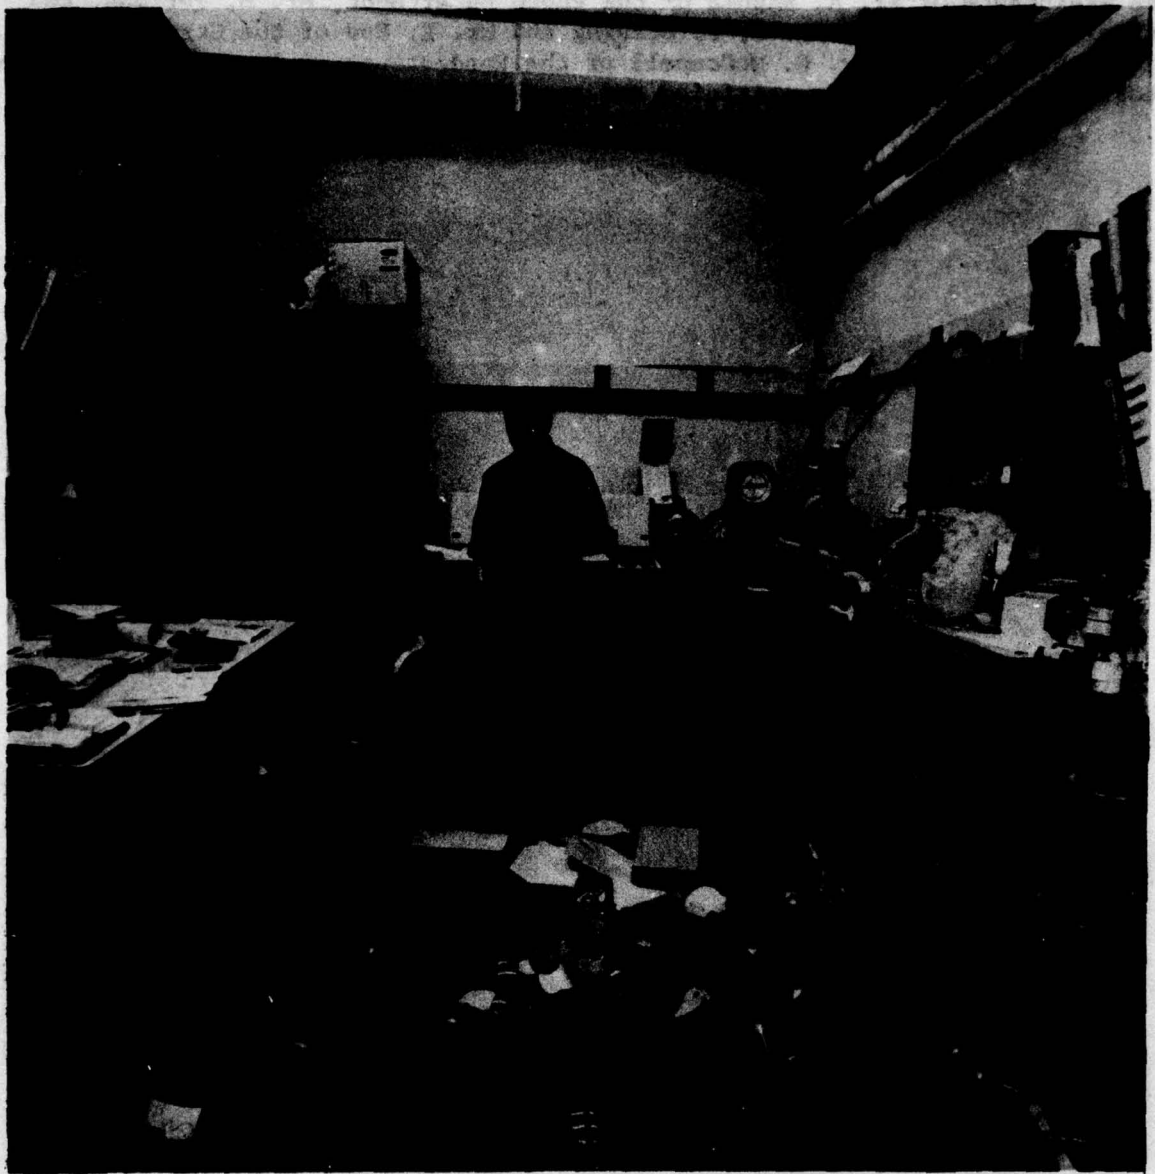


Figure 1. Room Where the Explosion Occurred

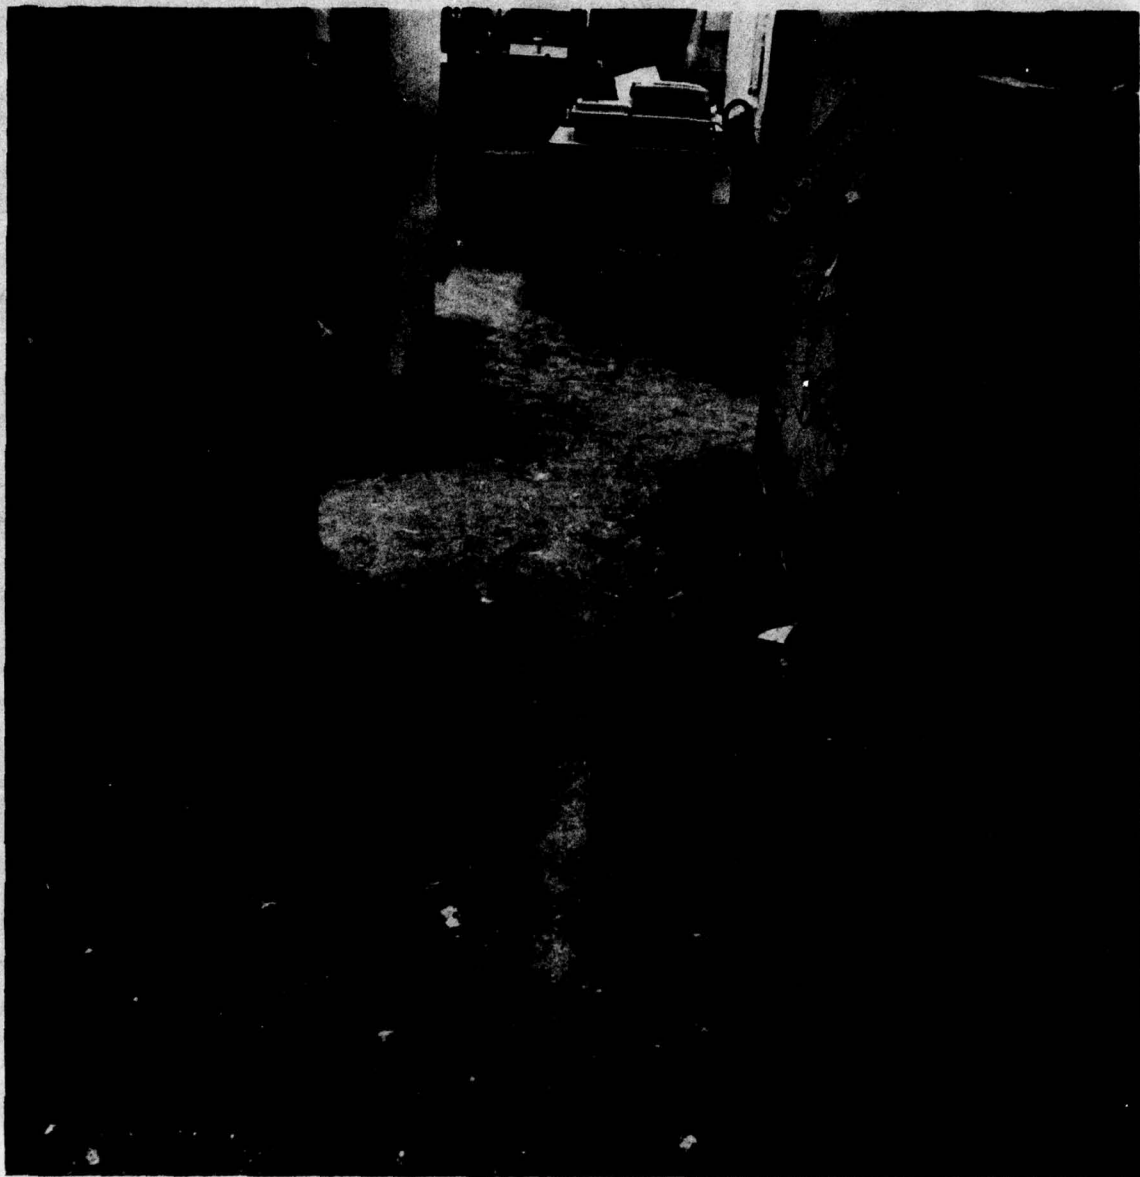


Figure 2. Adjacent Hallway with Portion of Cylinder and Steel Bands

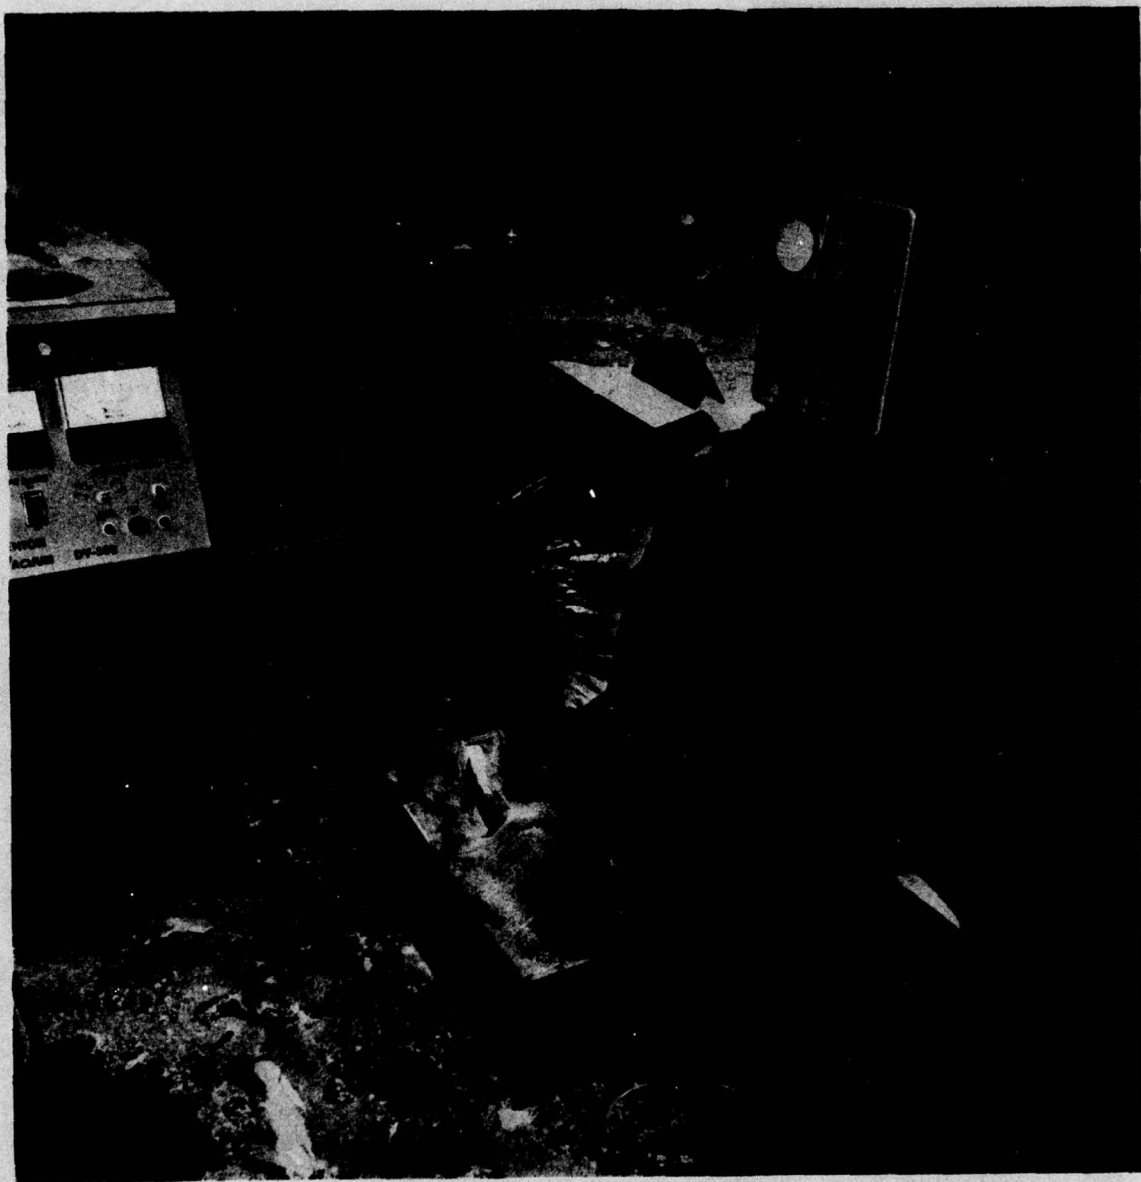


Figure 3. Damage to Adjacent Room

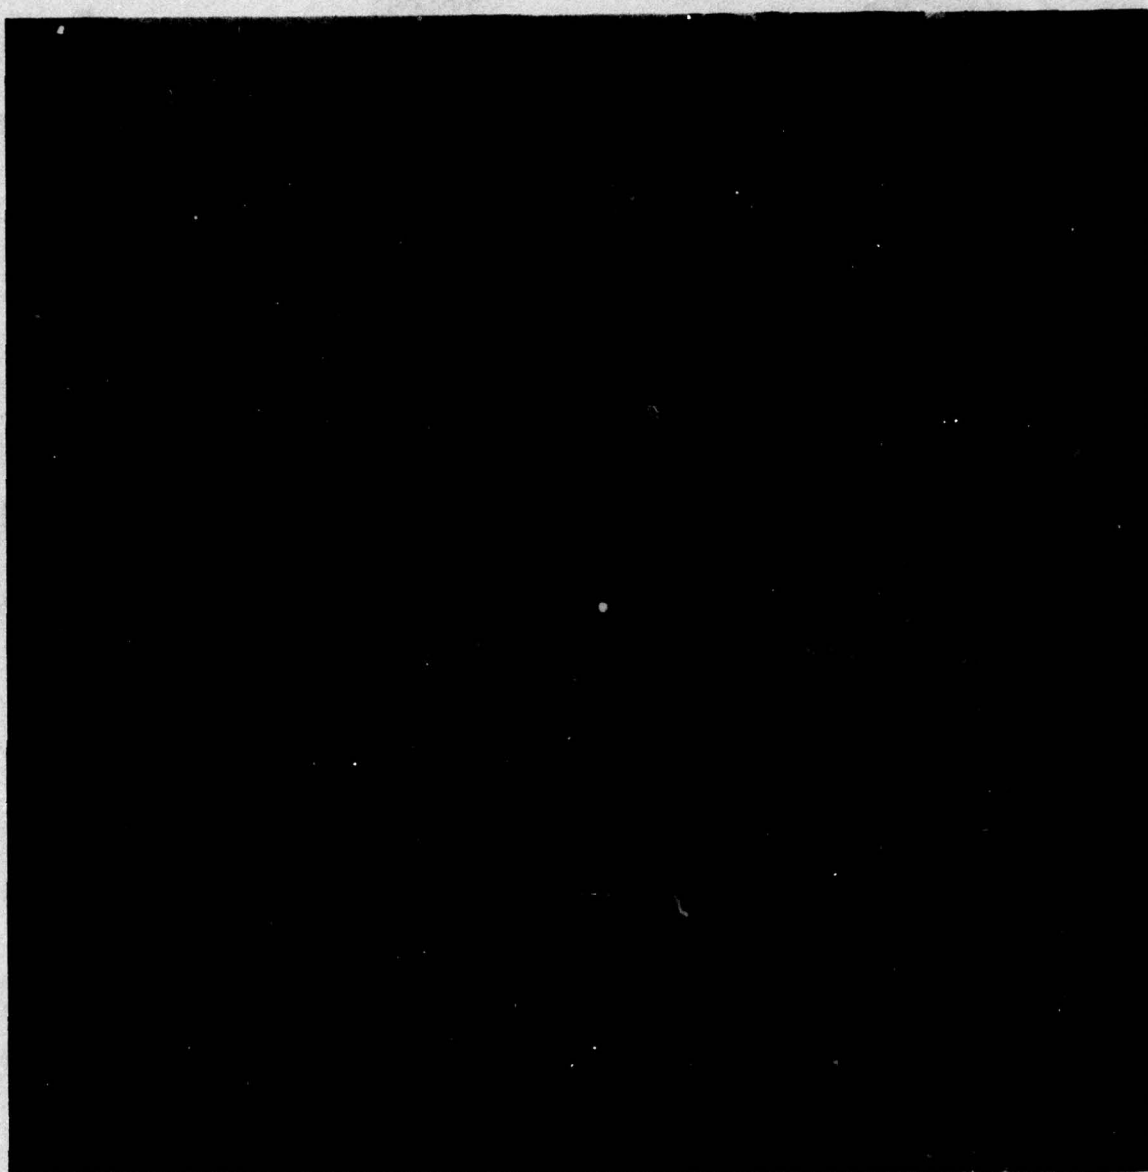


Figure 4. Typical G-276 LOX Cylinder in Stand Near Some Damage in Hallway.

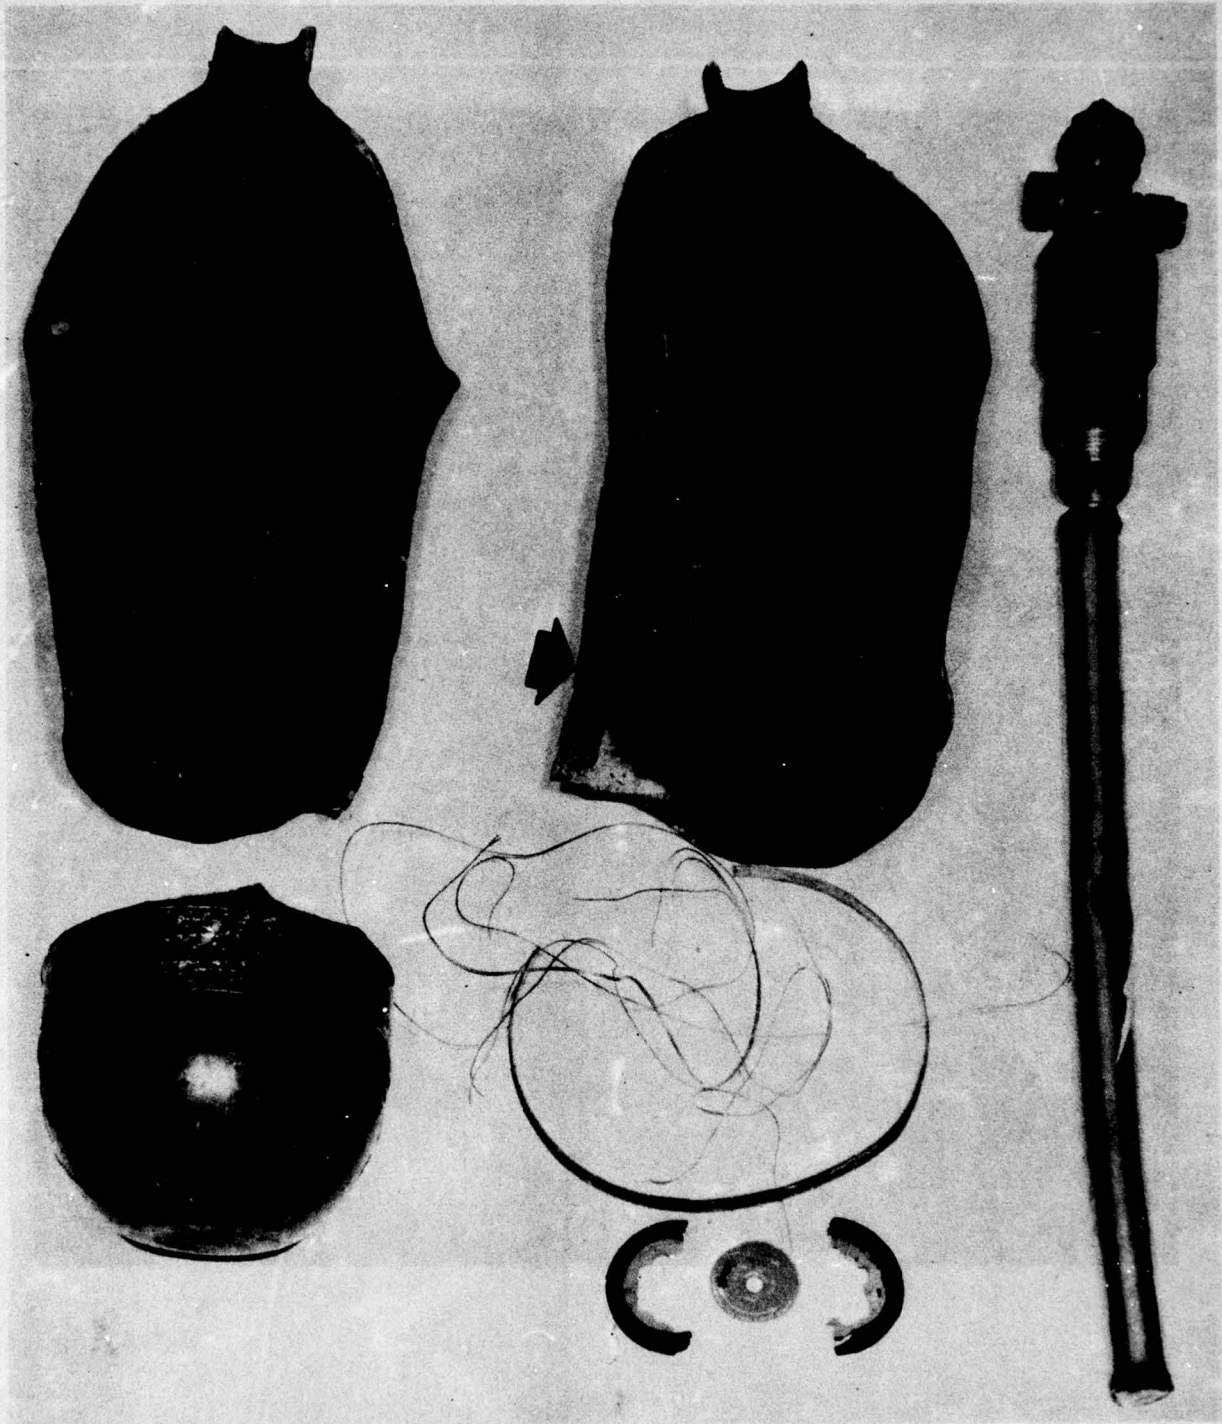


Figure 5. Parts of the Exploded Cylinder

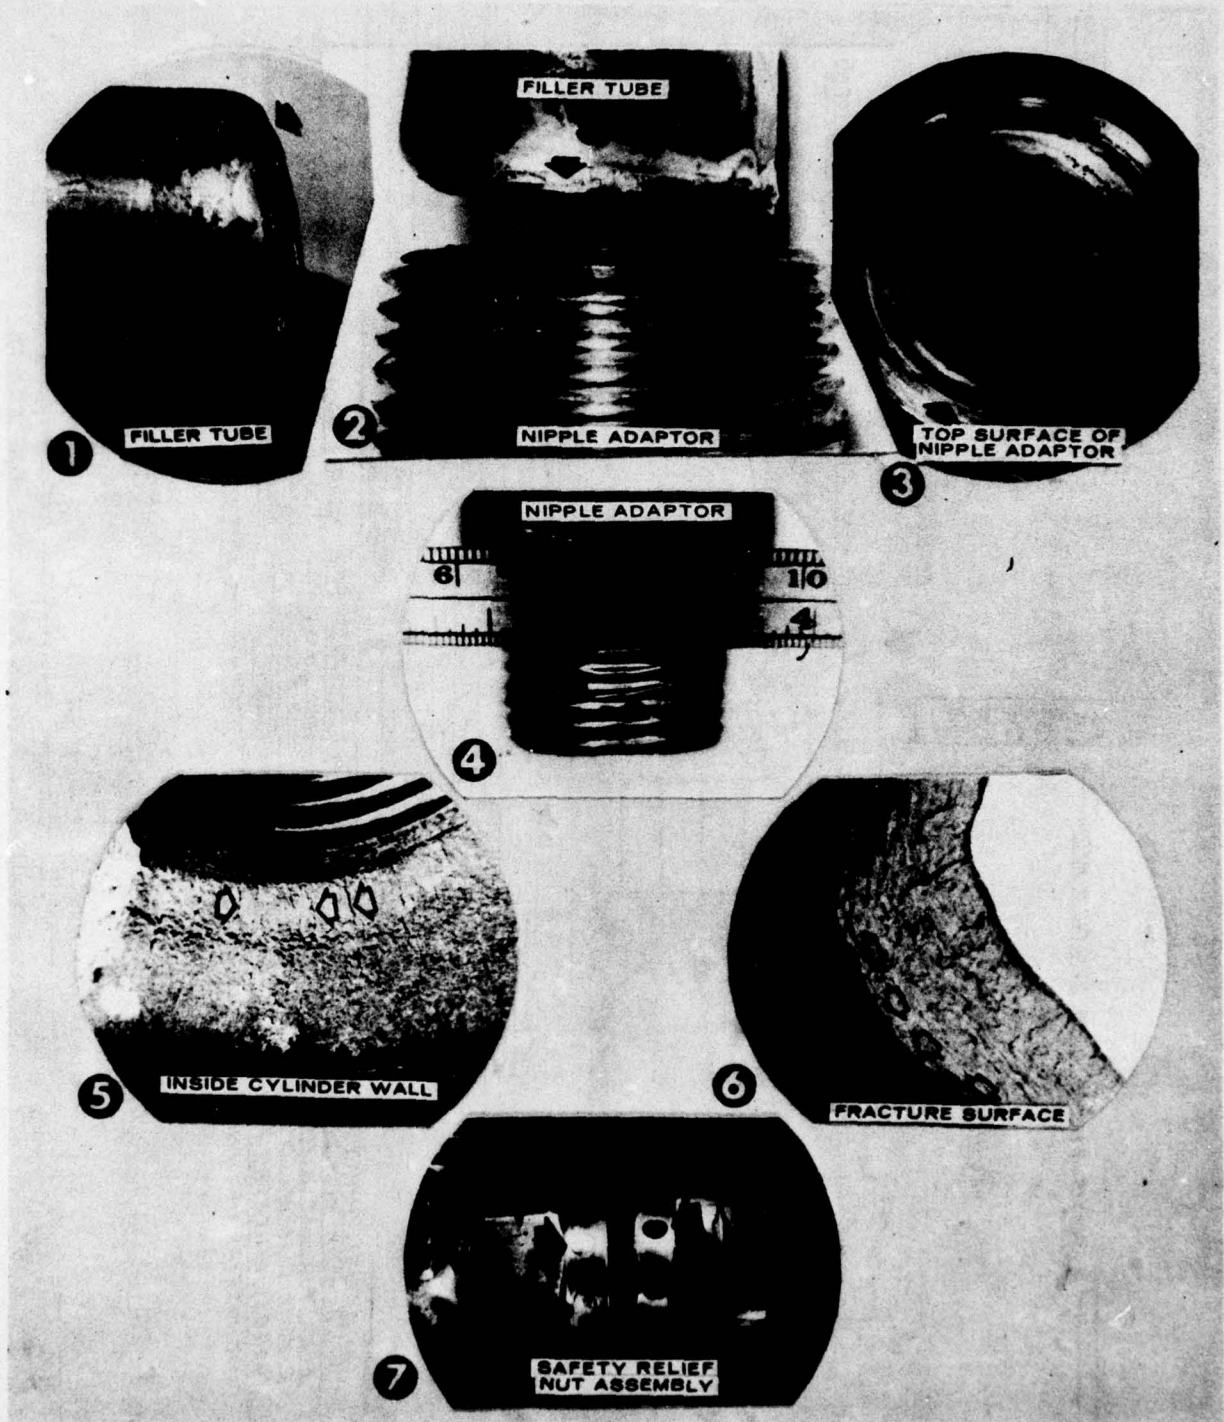


Figure 6. Detailed Photos of the Exploded G-276 Sampler

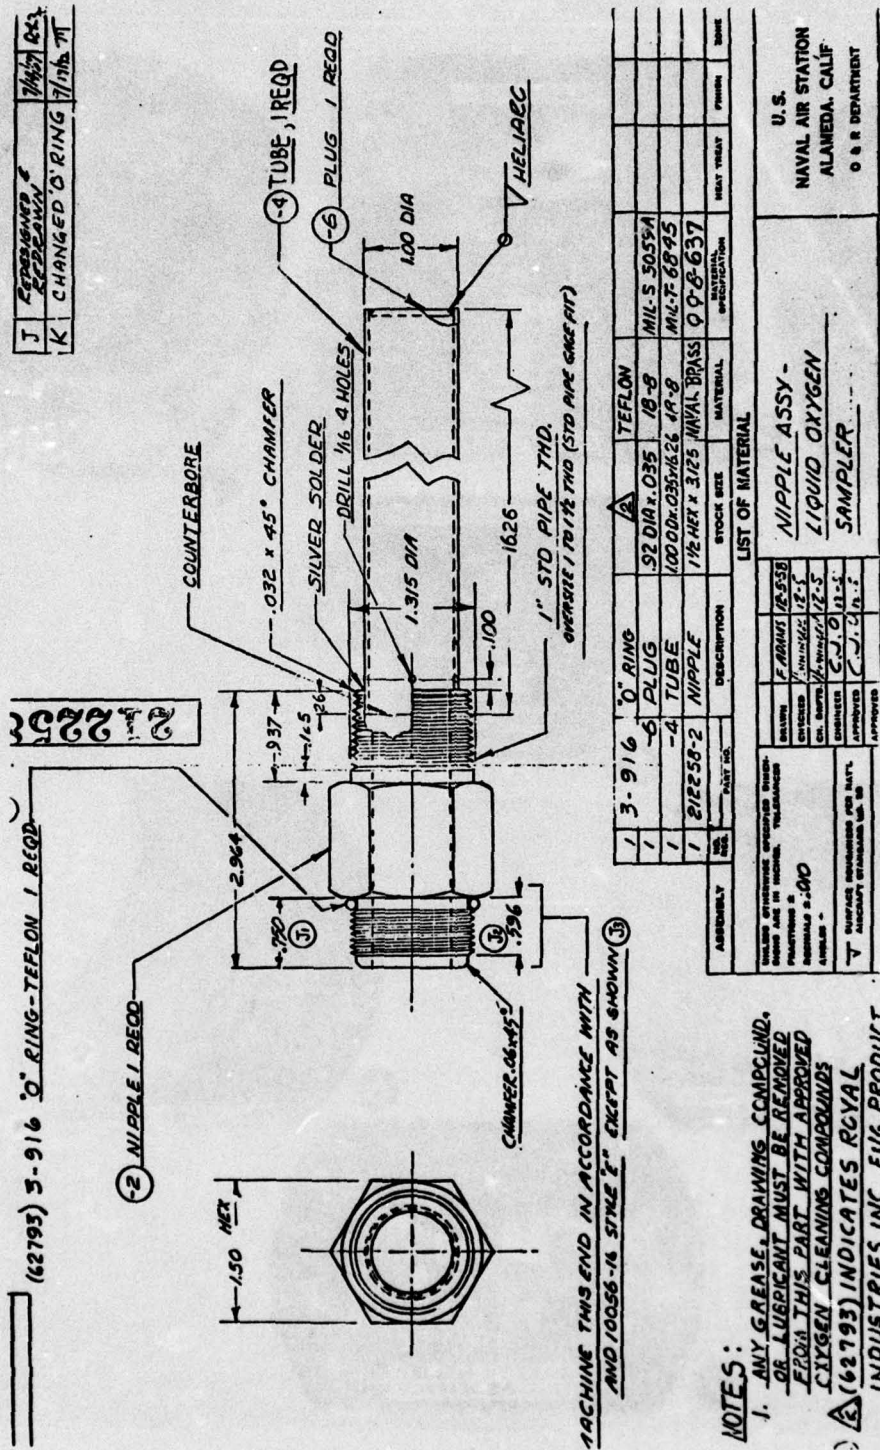


Figure 7. Specification Drawing of Nipple Assembly

APPENDIX A

INSPECTION OF G-276 LIQUID OXYGEN SAMPLER CYLINDERS

A P P E N D I X A

INSPECTION OF G-276 LIQUID OXYGEN SAMPLER CYLINDERS

1. Remove nipple assembly from the sampler cylinder.
2. Check external silver solder joint (refer to U. S. Naval Air Station, Alameda, California, O&R Department Drawing No. 212258 of 5 December 1958) for any irregularities between the nipple and the stainless steel tubing and the welded joint of the bottom cap. If the solder joint or the weld area has any defects such as insufficient solder, cracks, or visible porosity, discard the unit or send it to the shop for reworking.
3. Check stainless steel tubing internally (by inserting a right-angled scriber) to see if properly recessed (counterbored) 0.26" (0.66 cm) into nipple as shown in the No. 212258 drawing. If the silver solder joint is defective and/or the tubing is not recessed properly, it is emphasized that the unit should be discarded or reworked to conform to the above drawing.
4. If the valve safety disc is backed by a fusible alloy (drilled holes filled with metal), this material MUST be removed. The purpose of the fusible alloy is obviated since the intent of the G-276 sampler is not for the storage of compressed gases under high pressures in environments of extreme heat. The high-capacity packless cylinder valve used in G-276 LOX samplers MUST be fitted with an UNBACKED safety disc. Check the cylinder valve safety disc (Specification MIL-V-9439A) by removing the nut on the side opposite the valve outlet to see if the safety disc is the proper thickness (.00615 - .00665 in.) or if it bears a burst strength marking of 2700 to 3000 psi.
5. A suggested alternative to the present valve used on G-276 LOX samplers is to replace this valve with a modified high capacity packless cylinder valve with an unbacked safety disc assembly to which has been added a 2000 psi maximum pressure gauge drilled and tapped into the safety bore. The gauge will permit instantaneous detection of any excess pressure within the cylinder.
6. If, at any time, it is noted that the steel protection bands are broken on a G-276 LOX sampler, the cylinder should be discarded. Check the date when the cylinder was last hydrostatically tested. If outdated (5 years), send cylinder to the Naval Air Rework Facility for reworking and hydrostatic testing.
7. In the sampling operation, after filling the sampler with LOX, the cylinder should be examined for any evidence of frost appearing on the bottom or

excess frost near the top stem. Should this occur, the sampler should be vented to atmosphere immediately and resampling should be performed with an alternate sampler. The defective sampler should be checked as stated above in paragraphs 1 to 6 and reworked accordingly. In the case of the modified valve suggested under paragraph 5, a visual check on the pressure build-up should be made and excess pressure vented to the desired 500 psi.

NOTE: An eddy-current non-destructive technique for inspecting the stainless steel tube and nipple assembly has been suggested. When details of this procedure have been established, the technique will be available to facilitate the inspection of G-276 LOK cylinders.

D I S T R I B U T I O N L I S T

REPORT NO. NADC-76332-30

WORK REQUEST WR 5043W
Work Unit RH 301

	<u>No. of Copies</u>
NAVAIR (AIR 954)	18
2 for retention	
2 for AIR 4117	
2 for AIR 5203	
2 for AIR 52032	
2 for AIR 52032B	
2 for AIR 531A	
2 for AIR 5311B	
2 for AIR 4173	
2 for AIR 414D	
COMNAVAIREPLANT	2
COMNAVAIREPAC (Code 322C)	2
NAVAIRENGCEN (ESSD 92714)	2
NAVSAFCEEN, Norfolk, VA.	2
NAVAIREWORKFAC, Alameda	1
Jacksonville	1
Norfolk	1
North Island	1
Pensacola	1
MCAS, Cherry Point	1
KELLY AFB, (SQA), San Antonio, TX.	2
WPAFB, (SFQLA), Ohio.	2
NAVAIRDEVCEEN.	30
3 for 813	
2 for 30023	
1 for 20	
1 for 30	
1 for 40	
1 for 50	
1 for 60	
1 for 30P7	
1 for 301	
1 for 302	
12 for 3022	
1 for 303	
1 for 304	
1 for 305	
1 for 0243	
1 for 155	
NAVAIRFAC, Warminster, PA	2
1 for 10	
1 for 10B	
DDC	12